

Bell 430 Airworthiness Directive Status

Registration: N430TX

Aircraft TT: 2855.3

Serial Number: 49005

Date: 8-Nov-07

This list includes AD Note research through Bi-Weekly: 2007-22

Directive Number	Amdt. No.	Subject	Applicable Bulletin	Method of Compliance	Recurring		Complied With		Next Due		Signature & Certificate
					Yes	No	Date	Hours	Date	Hours	
2007-19-52	2007-SW-36-AD	Tail Rotor Blade Assembly	ASB 430-07-41 rev C	Inspect		XX	7-Nov-07	2855.3			T.Williams A&P 2119807
2006-13-14	39-14667	Tail Rotor Counterweight Bellcrank	ASB 430-04-30 rev. C	Replace or insp per para (a) each 50hrs	XX		26-Jun-07	2852.6	Bellcranks replaced. Insp. no longer required		TAS RV1R466K
2005-04-09	39-13981	Tail Rotor Blades	ASB 430-04-31 Rev. B	Insp per (a) each 3hrs - pilot	XX		-	-	-	-	Carried on inspection special sheet
2005-04-09	39-13981	Tail Rotor Blades	ASB 430-04-31 Rev. B	Insp per (c) each 50hrs - mechanic	XX		26-Jun-07	2852.6			TAS RV1R466K
2002-20-02	39-12897	Forward Tooling Hole in RH Upper Fuel Enclosure	ASB 430-01-21	Remove sealant		XX	4-Oct-02	28-Apr-04			Heli-Dyne VK1R561K
2002-01-07	39-12598	Electrical Power Distribution System	ASB 430-01-19 Rev. A	Mod. electrical system		XX	4-Oct-02	28-Apr-04			Heli-Dyne VK1R561K
2001-05-09	39-12146	Electrical Power Distribution System	ASB 430-99-10	Mod. electrical system		XX	15-Apr-01	1354.5			A&P 38343145
2001-01-51	39-12105	Main Rotor Hydraulic Actuator Support	ASB 430-00-17	Inspect per (a) each 600hrs & per (b) 30hrs after each installation	XX		26-Jun-07	2414.3	-	3614.3	Carried on inspection status sheet
2001-01-51PL	2000-SW-54-AD	Main Rotor Hydraulic Actuator Support	-	-	-	-	-	-	-	-	Replaced by AD 2001-01-51
2000-22-13	39-11959	Fuel Quantity Indicating System	ASB 430-99-13	Calibrate system per para (A)		XX	11-Nov-00	1219.6			A&P 38343145
2000-16-06	39-11860	Arm Clamp Screws	ASB 430-99-11	Replace screws & install guard		XX	13-Jan-01	1222.9			HAS GS1R177K
2000-16-04	39-11858	Main Rotor Adapter and Fluidic Dampers	ASB 430-97-2, ASB 430-97-4 & ASB 430-98-8	Inspect adapters, Restrict airspeed & replace damper set		XX	28-Sep-00	1168.0			A&P 38343145
99-23-03	39-11399	Vertical Fin Attachment Bolts	ASB 430-98-5	Torque check per para (d) each 150 hrs - mechanic	XX		-	2845.1		2995.1	Carried on inspection status sheet
99-23-03	39-11399	Vertical Fin Attachment Bolts	ASB 430-98-5	Torque check & modification per para (a & b)		XX	6-Dec-99	960.5			A&P 38343145
98-24-31	39-10998	Forward Fairing and Lateral Control Tube	ASB 430-98-6	Mod. fairing & relpace control tube		XX	23-Feb-99	743.0			Premier Aviation IPTR140L

Blue = Recurring Compliance

Bell 430 Airworthiness Directive Status

Registration: N430TX

Aircraft TT: 2855.3

Serial Number: 49005

Date: 8-Nov-07

This list includes AD Note research through Bi-Weekly: 2007-22

Directive Number	Amdt. No.	Subject	Applicable Bulletin	Method of Compliance	Recurring		Complied With		Next Due		Signature & Certificate
					Yes	No	Date	Hours	Date	Hours	

Red = Pending Compliance